



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D117-762-041
Job Sheet 181940



Part No: D117-762-041

Job Qty: 1 ea

Part Name: Replacement Skidtube



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 8/13/18

Job Tracking No:

Due Date: 8/20/18

Created By: Marie Lajeunesse

Type: SOLD

Description:

Note: DWG D3582 REV E IPP Rev:A 07.06.11 New Issue EC IPP Rev:B 08-02-22 change to revA as per dwg DD verF by:EC IPP REV:C 15.06.11 AS PER CHG002 DD VERF:JLM IPP REV:D 16.02.05 DWG REV:C (ecn16-514) DD VERF:JLM IPP REV:E 17.01.17 as per dwg REV.D DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea	8/20/18	8/20/18	0.00	0.00	Start Up Skidtubes-1		BE
130	Skidtubes	1 pcs	8/20/18	8/20/18	0.00	3.47	Skidtubes-1		BE
140	Skidtubes	1 pcs	8/20/18	8/20/18	0.00	3.47	Skidtubes-1		BE
150	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC10		D 18/09/18
160	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC5		D 18/09/18
170	HandFinish	1 pcs	8/20/18	8/20/18	0.00	0.97	HandFinish1		D 18/09/18
180	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC7-1		BE
190	Skidtubes	1 pcs	8/20/18	8/20/18	0.00	3.47	Skidtubes-1		BE
200	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC10		BB DAS
210	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC5		9-89 38
215	HandFinish	1 pcs	8/20/18	8/20/18	0.00	0.97	HandFinish2		D 18/09/18
220	Powdercoat	1 pcs	8/20/18	8/20/18	0.00	0.26	Powdercoat1		BE 18-9-11
230	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC3		BE
250	HandFinish	1 pcs	8/20/18	8/20/18	0.00	0.97	HandFinish4		BE 18-9-11
260	QC	1 pcs	8/20/18	8/20/18	0.00	0.00	QC5		SEP 12 2018 68
270	Packaging	1 pcs	8/20/18	8/20/18	0.00	0.00	Packaging3-1		SEP 13 2018 9-89
275	DC	1 pcs	8/20/18	8/20/18	0.00	0.00	DC		SEP 13 2018
280	QC21-FG	1 Ea	8/20/18	8/20/18	0.00	0.00	QC21		SEP 13 2018

Part Op 130 - 1-Cut Aft end using DT8185 2-Deburr ends 3-Drill Aft Cap holes using DT8678 *** OPEN AFT CAP HOLE TO .187"

Descriptions: *** 4-Locate DT 8973 from aft cap holes & Drill Ground wire hole on top of Tube. 5-Install 3/16 cleco in Ground wire hole ,then drill all X-Bolt holes using 3/16" drill. 6-Drill pilot holes for wearplates using DT8900 7-Open wearplate holes to Ø19/64" (0.297") as per Dwg D3582. 8-Drill holes for D5520-1 doubler using DT10309 A & B, locating from 4th and 5th crossbolt holes from aft using .1875 clekos. Spot drill tube using #20 drill (note 10). Remove DT10309 B. Re-install DT 10309 A drill thru tube and doubler using #20 drill (note 10)l, cleco as you go. Remove .1875 clekos and open holes in tube and doubler to 0.750". Remove doublers and identify orientation. 9-Deburr doubler and doubler holes in skid tube. 10-Countersink doubler holes in skid tube as per Dwg. detail J and note 12 -Touctch up alodine on D5520-1 doublers. 11-open ground wear holes to 0.391" as per section B-B 12-Open Aft Cap holes using .209" drill. 13-Drill pilot holes for section D-D and E-E. Holes must be laid out by hand. Mark out Center line and make sure that 6.65 and 5.906 measurements are respected. Double check before drilling, do not open holes to finish size. 12-Do not open holes of section G-G to finishes size.

140 - 1-Weld fwd cap D2964 per dwg D3582 and QSI 004 A/R AL ROD Batch: 136158 2-Grind flush

190 - ***MASK OFF HOLES OF SECTION F-F (DO NOT C'SINK) 1-Open X-Bolt holes to finish size as per Dwg D3582, sections D-D, E-E, G-G as per Dwg. 2-Counter Sink X-BOLT holes as per Dwg D3582 D-D, E-E and G-G.***Do NOT

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____ Date : _____ _____ _____	Instructions: FAA STC SR01853SE 15/04/2015 STC LOA RDIMS - 4374899 08/01 Exp Date: _____ Inspector: _____ Revision: _____ Serial No/Batch: S103033 Part: D117-762-041 Job No: 181940 Container No: S103033 DART AEROSPACE 12710 Acorn Street Hawkesbury, ON K6A 1K7 CANADA TEL: 1 813 832-8200 Email: sales@dartaero.com www.dartaerospace.com	DEPARTMENT/PROCESS <table style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 50%;">Water Jet ☐</td> <td style="width: 50%;">Engineering ☐</td> </tr> <tr> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Supplier ☐</td> <td></td> </tr> </table> MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	Water Jet ☐	Engineering ☐	Prod. Eng. Coord. ☐	Quality ☐	Rec/Store/Packaging ☐	Other ☐	Supplier ☐	
Water Jet ☐	Engineering ☐									
Prod. Eng. Coord. ☐	Quality ☐									
Rec/Store/Packaging ☐	Other ☐									
Supplier ☐										

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____					
Misidentified ☐	Past Due ☐						

countersink holes of section F-F). 3-Deburr and blow out chips from inside of tube, prep. tube for welding. 4-Install doublers using DT10309 B. Shave rivets as required. 5-Bond web as per Dwg D3582 & QSI 015 A/R 241 Sika Flex Batch: M138874 Exp Date: 12/03/06 6- Swage x-bolt spacer as per dwg and Section F-F QSI002. 7-Weld x-bolt spacers as per Dwg D3582 section D-D, E-E and G-G. A/R AL ROD Batch: 136158 8-Grind welds flush

215 - Touch-up alodine as per QSI

220 - START TIME 11:50 OVEN TEMPERATURE: 320° FINISH TIME: 12:20 M 83893.

250 - 1-Inspect for Foreign objects 2-Install Aft cap as per Dwg D3582, Detail "C" A/R 241 Sika Flex

Batch: M138874 Exp Date: 06/19 3-Install Wearplates as per Dwg D3582, Note: Install Bolt and washer on Ground Wire inserts on top of tube see section D-D of dwg D3582 *****Do not install bolts where indicated on Dwg(Note #6)***** 4- Wing Walk as per Dwg D3582 and QSI 005 4.4 M138935

270 - Identify and pack for shipping as per PPP D117-762-041 Location :FG081

275 - Photocopy bluefile & type labels per PPP D117-762-041 CHG003

M.U. 005391

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D3582-1-BENT	Skidtube Assembly BK117	1 Ea (1 ea)	90-Start up Operation	<u>5089216</u>
D5520-1	Doubler	2 Ea (2 ea)	130-Skidtubes	<u>5082764</u>
D2964	Cap	1 Ea (1 ea)	140-Skidtubes	<u>5077380</u>
CR3212-5-05	Rivet	68 pcs (68 ea)	190-Skidtubes	<u>508089456</u>
D2971	Cross Bolt Spacer	1 Ea (1 ea)	190-Skidtubes	<u>5090635</u>
D3584-1	Web	1 Ea (1 ea)	190-Skidtubes	<u>5046035</u>
D3662-1	Crossbolt Spacer	3 Ea (3 ea)	190-Skidtubes	<u>5096879</u>
D3662-3	Crossbolt Spacer	1 Ea (1 ea)	190-Skidtubes	<u>F816006</u>
D5304-1	Crossbolt Spacer	2 Ea (2 ea)	190-Skidtubes	<u>5043581</u>
ALS4-1032-130	Rivnut	36 Ea (36 ea)	250-HandFinish	<u>5007279</u>
ALS4-428-165	Insert	2 Ea (2 ea)	250-HandFinish	<u>5058145</u>
AN3C4A	Bolt	28 Ea (28 ea)	250-HandFinish	<u>5095223</u>
AN4-4A	Bolt	2 Ea (2 ea)	250-HandFinish	<u>5045482</u>
D2965	Cap	1 Ea (1 ea)	250-HandFinish	<u>5057794</u>
D3508-11	Wearplate Aft Center	1 Ea (1 ea)	250-HandFinish	<u>5089509</u>
D3508-13	Wearplate Aft	1 Ea (1 ea)	250-HandFinish	<u>5045056</u>
D3508-3	Wearplate Fwd Center	1 Ea (1 ea)	250-HandFinish	<u>5045058</u>
D3508-9	Wearplate Fwd	1 Ea (1 ea)	250-HandFinish	<u>5058253</u>
D3558-11	Gasket Aft Center	1 Ea (1 ea)	250-HandFinish	<u>5058233</u>
D3558-13	Gasket Aft	1 Ea (1 ea)	250-HandFinish	<u>5077343</u>
D3558-3	Gasket Center Fwd	1 Ea (1 ea)	250-HandFinish	<u>5058245</u>
D3558-9	Gasket Fwd	1 Ea (1 ea)	250-HandFinish	<u>5071663</u>
NAS1149C0332R	Washer	28 Ea (28 ea)	250-HandFinish	<u>18035396-2</u>
NAS1149D0332J	Washer	2 Ea (2 ea)	250-HandFinish	<u>18035396-2</u>
NAS1149D0416J	Washer	2 Ea (2 ea)	250-HandFinish	<u>FM131511</u>
<u>AN3-5A</u>	<u>BOLT</u>	<u>2Ea(ea)</u>	<u>250-HandFinish</u>	<u>5095480</u>

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D3582-1-BENT	1	3	0
130-Skidtubes	D5520-1	2	28	0
140-Skidtubes	D2964	1	9	0
190-Skidtubes	CR3212-5-05	68	950	0
	D2971	1	38	0
	D3584-1	1	2	0
	D3662-1	3	10	0
	D3662-3	1	31	0
	D5304-1	2	43	0
250-HandFinish	ALS4-1032-130	36	13,028	0
	ALS4-428-165	2	60	0
	AN3C4A	28	2,819	0
	AN4-4A	2	28	0
	D2965	1	60	0
	D3508-11	1	9	0
	D3508-13	1	11	0
	D3508-3	1	9	0
	D3508-9	1	10	0
	D3558-11	1	9	0
	D3558-13	1	11	0
	D3558-3	1	12	0
	D3558-9	1	12	0

DAS
10
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

NAS1149C0332R	28	4,971	0
NAS1149D0332J	2	2,803	0
NAS1149D0416J	2	2,894	0

Part Specifications

Specifications could not be found.

Plex 8/14/18 7:00 AM Dart.lajeunesse.marie

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

ITEM	Qty -041	Part Number	Description
	X	D3582-041	SKIDTUBE ASSEMBLY
1	1	D2962-150	EXTRUSION
2	1	D2964	CAP
3	1	D2965	CAP
4	1	D2971	CROSS BOLT SPACER
5	1	D3508-3	WEARPLATE
6	1	D3508-9	WEARPLATE
7	1	D3508-11	WEARPLATE
8	1	D3508-13	WEARPLATE
9	1	D3558-3	GASKET
10	1	D3558-9	GASKET
11	1	D3558-11	GASKET
12	1	D3558-13	GASKET
13	1	D3584-1	WEB
14	3	D3662-1	CROSS BOLT SPACER
15	1	D3662-3	CROSS BOLT SPACER
16	2	D5304-1	CROSS BOLT SPACER
17	2	D5520-1	DOUBLER
18	28	AN3C4A	BOLT
19	2	AN3-5A	BOLT
20	2	AN4-4A	BOLT
21	28	NAS1149C0332R	WASHER (AN960C10L)
22	2	NAS1149D0332J	WASHER (AN960JD10L)
23	2	NAS1149D0416J	WASHER (AN960JD416L)
24	36	AELS-1032-130	INSERT
25	2	ALS7-428-165	INSERT
26	68	CR3212-5-05	CSK RIVET, CHERRY MAX

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 1819 40 MJS
18-08-14

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB. POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3. ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 18.2 lbs
- 8) WELDING: PER DART QSI 004.
- 9) INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- 10) USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL Ø0.297 HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
- 11) DO NOT INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS IN INDICATED LOCATIONS
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309. COUNTERSINK Ø0.286 x 100° (34 PL) PER DOUBLER AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS.

RELEASED
2017-08-11
EN 17-547

E	MOVE VIEWS FROM SHT 1 TO SHT 2. ADD ITEMS 17 & 26 AND NOTE 12-13. Ø0.187 HOLE WAS Ø0.75. ADD SHT 3, ADD DETAIL J. SECTION F-F ADD D5520-1. SCALE ON VIEWS WAS 3X.	AJS	17.03.27
D	D5304-1 WAS D2973; REVISE BOM & SECTION F-F & SECTION NOTES (ZN B7-3, A8-3); REF NCR16-6160	RF	17.01.09
C	D3492 PLUG ASSEMBLIES REMOVED. REFORMAT NOTES SHT 1	AP	15.11.02
B	29.88 WAS 29.87 (ZN C2-1), INCORPORATED DEO D3582-A-1 (ZN D5-1), FORMAT TO CURRENT STD	RF	15.02.20
A	NEW ISSUE	PH	07.06.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	AJS		
CHECKED	MJS	DRAWING NO.	REV. E
MFG. APPR.	DP	D3582	SHEET 1 OF 4
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

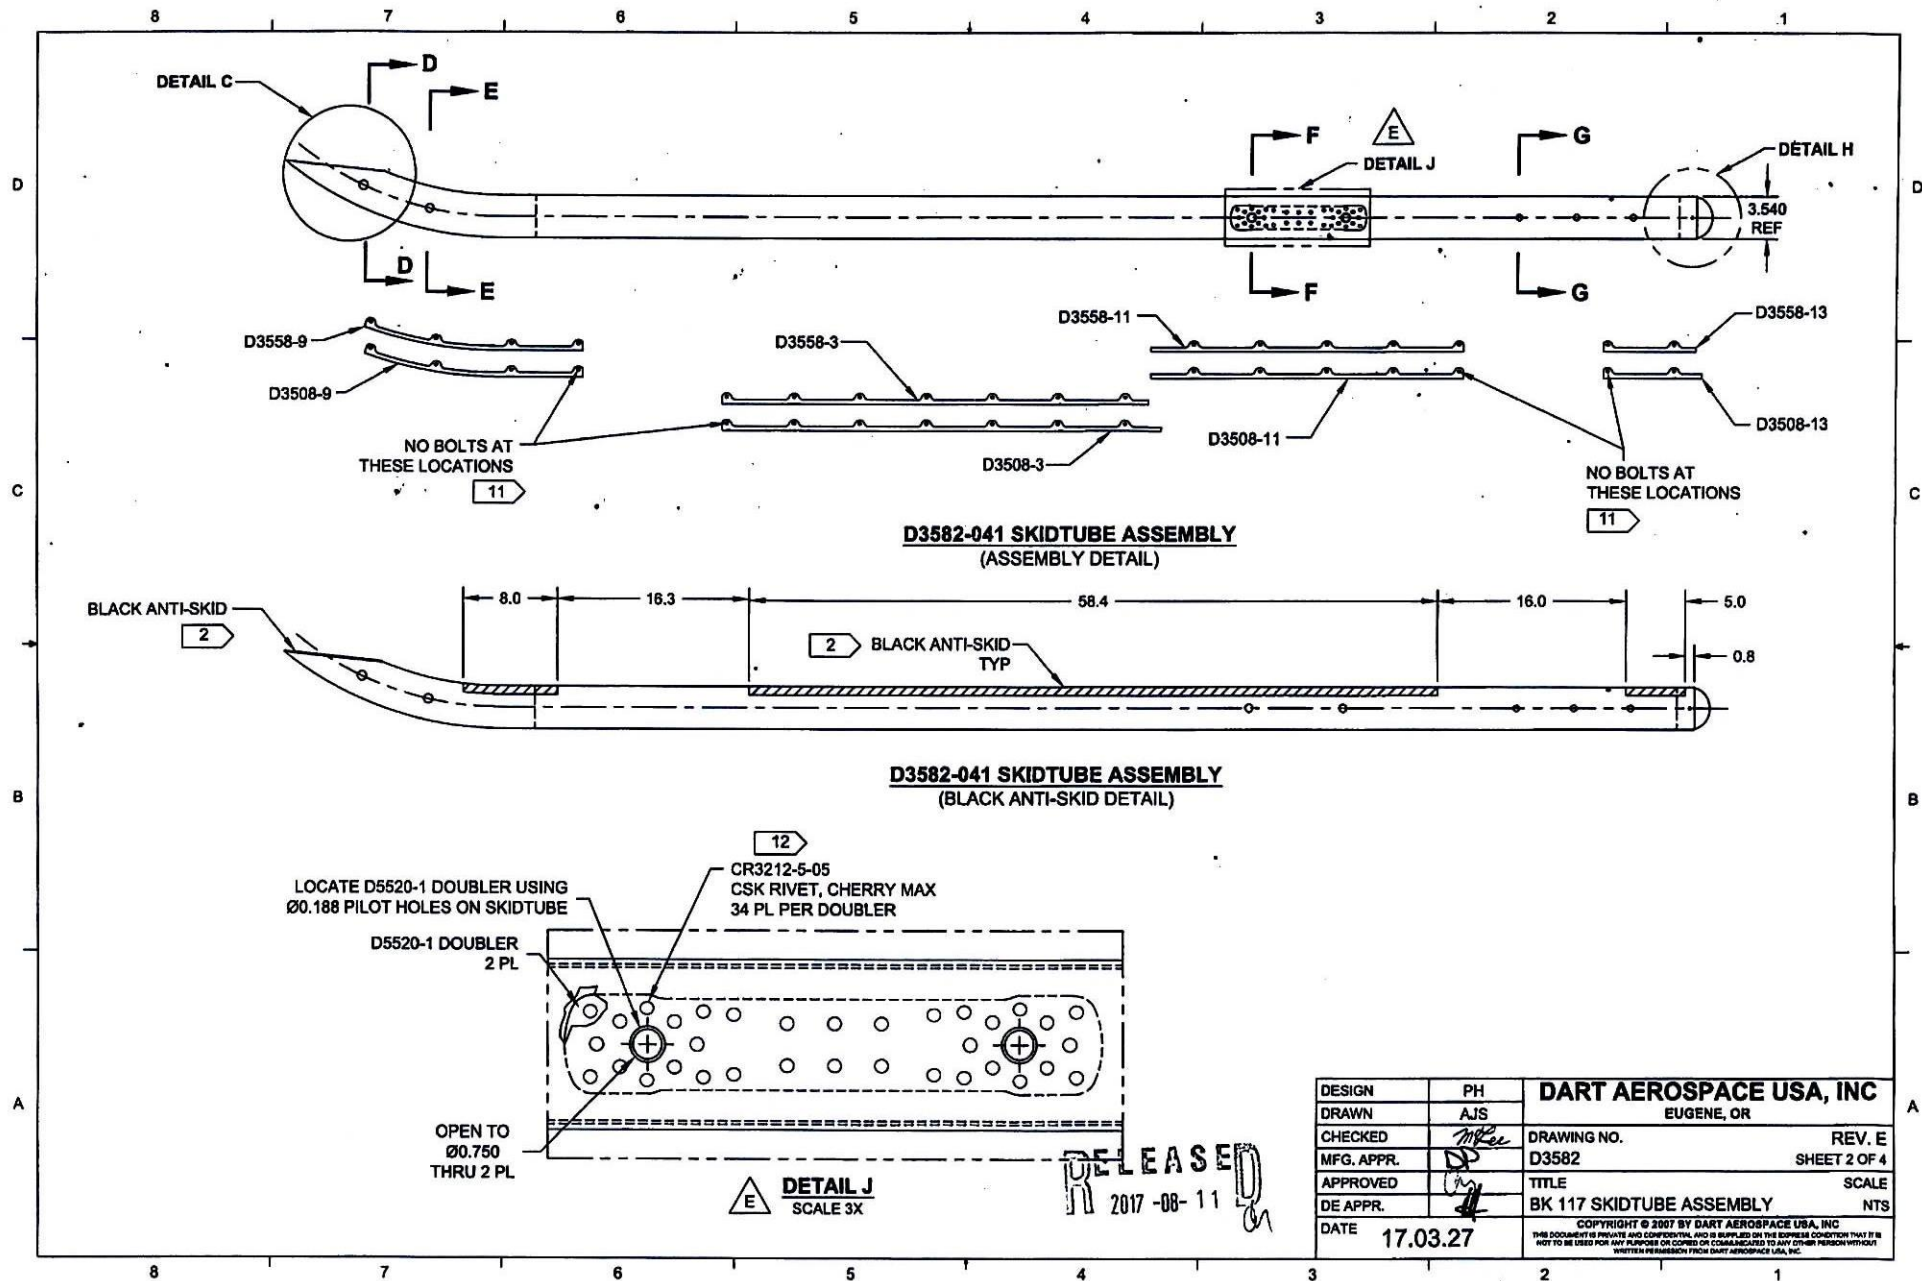

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

8 7 6 5 4 3 2 1

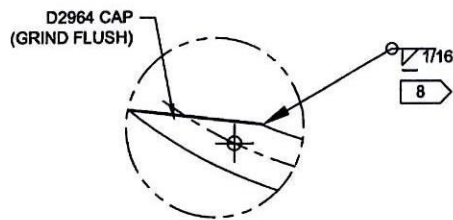


DETAIL C
SCALE 4X

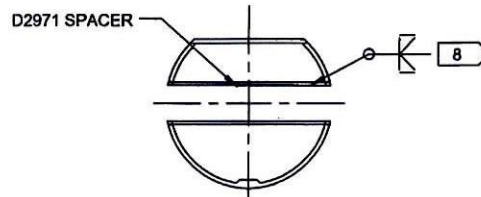


SECTION D-D
SCALE 4X

- SECTION D-D NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D2971 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER

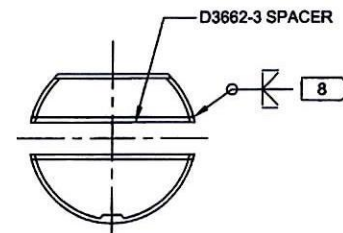


SECTION E-E
SCALE 4X

- SECTION E-E NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-3 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER

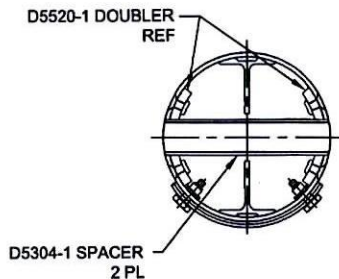


SECTION F-F
SCALE 4X
2 PL

- SECTION F-F NOTES**
AFTER BENDING AND DRILLING ASSY
PERFORM THE FOLLOWING:
1. INSERT D5304-1 SPACER
 2. SWAGE TO Ø0.565 +0.005/-0.000 X 1.0 DEEP PER QSI 002
 3. OPEN THRU HOLE TO Ø0.625
 4. GRIND FLUSH

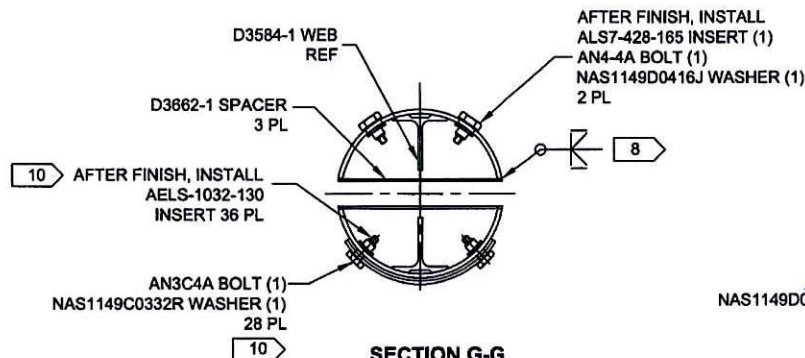

SECTION G-G
SCALE 4X

- SECTION G-G NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-1 SPACER (3 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER

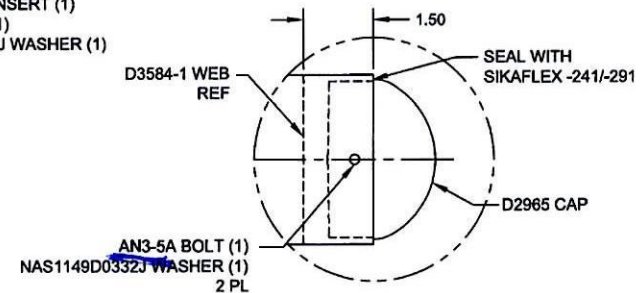

DETAIL H
SCALE 4X

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	<i>mlee</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>SP</i>	D3582	SHEET 3 OF 4
APPROVED	<i>SP</i>	TITLE	SCALE
DE APPR.	<i>SP</i>	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2017-08-11


DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

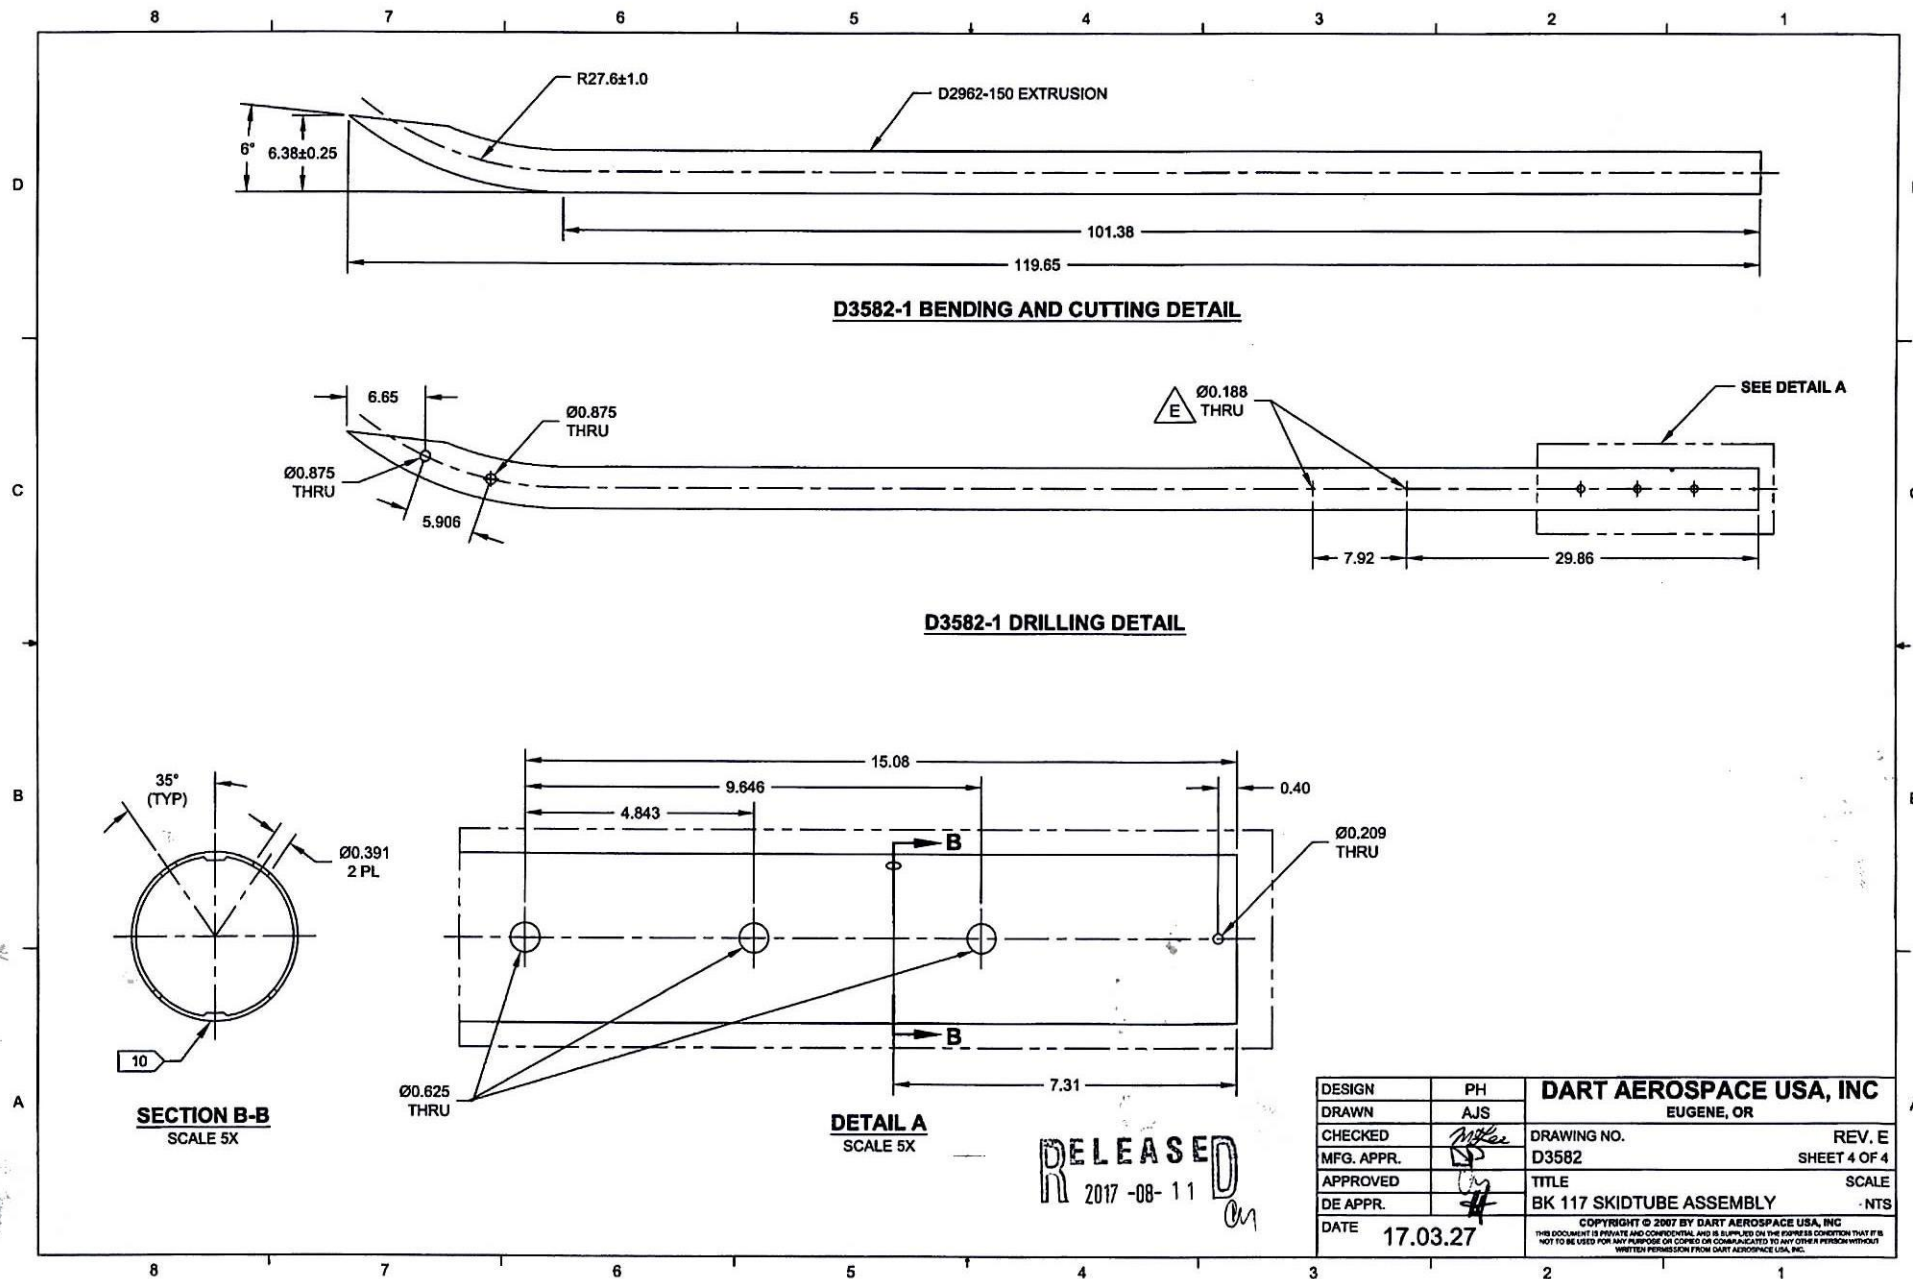

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	<i>MKS</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>[Signature]</i>	D3582	SHEET 4 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																													
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																											
Description Work Order Deviation			Disposition																																																																												
			Completed By																																																																												
			Lead hand / Supervisor Approval Verification																																																																												
			QC / QA Coordinator Approval																																																																												
<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th colspan="3" style="text-align: left;">Root Cause</th> <th colspan="3" style="text-align: left;">FAULT CATEGORY</th> </tr> </thead> <tbody> <tr> <td style="width: 15%;">Environment ☐</td> <td style="width: 15%;">No Re-verification ☐</td> <td style="width: 15%;">Pressure/Forced ☐</td> <td style="width: 15%;">Temperature/Cure ☐</td> <td style="width: 15%;">Power Loss/Surge ☐</td> <td style="width: 15%;">Positioned Wrong ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> <td colspan="4" rowspan="2" style="vertical-align: top;">OTHER : _____</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </tbody> </table>						Root Cause			FAULT CATEGORY			Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____				Misidentified ☐	Past Due ☐
Root Cause			FAULT CATEGORY																																																																												
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																										
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																										
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																										
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																										
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																										
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																										
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																										
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																										
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																										
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																										
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____																																																																													
Misidentified ☐	Past Due ☐																																																																														